


MasterMig 353, 355

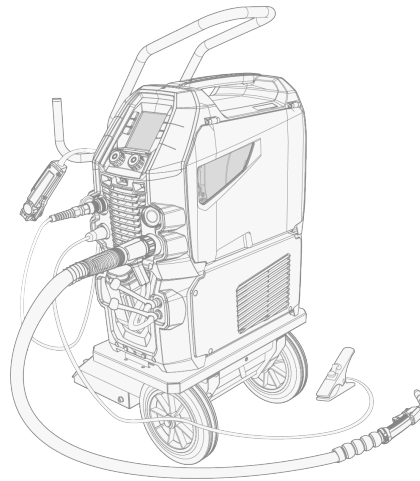

CONTENTS


1. General	4
1.1 Equipment description	6
1.2 MasterMig device	7
1.2.1 Wire feed mechanism	8
1.3 MasterMig Cooler cooling unit (optional)	10
2. Installation	11
2.1 Installing power source mains plug	12
2.2 Installing cooling unit (optional)	13
2.3 Installing equipment on cart (optional)	15
2.4 Connecting welding gun	17
2.5 Connecting earth return cable	18
2.6 Installing remote control (optional)	19
2.7 Installing and changing wire	20
2.8 Installing and replacing feed rolls	25
2.9 Installing and replacing wire guide tubes	27
2.10 Installing gas bottle and testing gas flow	28
3. Operation	30
3.1 Preparing welding system for use	31
3.1.1 Filling cooler and circulating coolant	31
3.2 Calibrating welding cable	33
3.3 Using control panel	34
3.3.1 Control panel: Main view	35
3.3.2 Control panel: Memory channels	37
3.3.3 Control panel: Welding process	37
3.3.4 Control panel: Trigger logic	38
3.3.5 Control panel: Weld Assist	39
3.3.6 Control panel: Welding parameters	40
3.3.7 Control panel: System settings	42
3.3.8 Control panel: Weld data	44
3.4 Additional guidance to functions and features	45
3.4.1 1-MIG	45
3.4.2 Pulse welding	45
3.4.3 MAX Cool process	45
3.4.4 MAX Position process	46
3.4.5 MAX Speed process	46
3.4.6 Trigger logic functions	47
3.4.7 WiseFusion feature	48

3.4.8 WeldEye with DCM (optional)	48
3.5 Using remote control	50
3.6 Changing welding polarity	51
3.7 Lifting MasterMig equipment	52
4. Maintenance	53
4.1 Daily maintenance	54
4.2 Periodic maintenance	55
4.3 Service workshops	56
4.4 Troubleshooting	57
4.5 Error codes	59
4.6 Installing and cleaning power source air filter (optional)	61
4.7 Disposal	63
5. Technical data	64
5.1 MasterMig devices	65
5.2 MasterMig cooling unit	69
5.3 Wire feeder consumables	70
5.4 MasterMig ordering info	72

1. GENERAL

These instructions describe the use of Kemppi's MasterMig welding equipment designed for light- to medium-duty professional use in MIG/MAG welding.

MasterMig welding machines include both manual and automatic welding processes. Pulse welding is possible with the MasterMig 355 series machines.

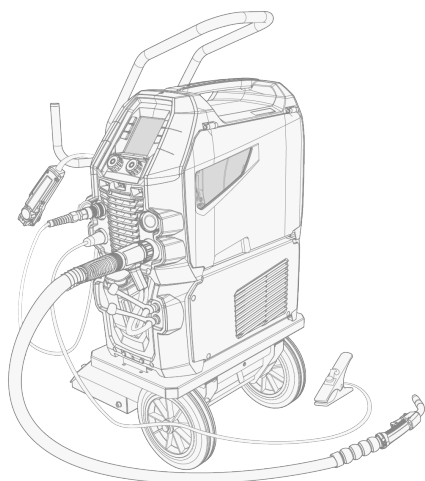

MasterMig series:

MasterMig product series	MasterMig device model
MasterMig 353	MasterMig 353 G
	MasterMig 353 GM
MasterMig 355	MasterMig 355 G
	MasterMig 355 GM

MasterMig is designed to be used together with Kemppi's Flexlite GX MIG welding guns with euro connector.

MasterMig can be used also for TIG * and MMA ** welding.

* TIG welding requires the use of a dedicated Flexlite TX TIG torch with euro connector.

** MMA welding requires a dedicated DIX-euro adapter.

Important notes

Read the instructions through carefully. For your own safety, and that of your working environment, pay particular attention to the safety instructions delivered with the equipment.

Items in the manual that require particular attention in order to minimize damage and harm are indicated with the below symbols. Read these sections carefully and follow their instructions.

 *Note: Gives the user a useful piece of information.*

 *Caution: Describes a situation that may result in damage to the equipment or system.*

 *Warning: Describes a potentially dangerous situation. If not avoided, it will result in personal damage or fatal injury.*

Kempfi symbols: [Userdoc](#).

DISCLAIMER

While every effort has been made to ensure that the information contained in this guide is accurate and complete, no liability can be accepted for any errors or omissions. Kempfi reserves the right to change the specification of the product described at any time without prior notice. Do not copy, record, reproduce or transmit the contents of this guide without prior permission from Kempfi.

1.1 Equipment description

MasterMig device models (350 A)

- MasterMig 353 G
 - >> Generator-compatible
 - >> Standard device with automatic 1-MIG process
- MasterMig 353 GM
 - >> Generator-compatible and multi-voltage
 - >> Standard device with automatic 1-MIG process
- MasterMig 355 G
 - >> Generator-compatible
 - >> Pulse device with automatic 1-MIG and pulse processes. Advanced MAX processes as optional.
- MasterMig 355 GM
 - >> Generator-compatible and multi-voltage
 - >> Pulse device with automatic 1-MIG and pulse processes. Advanced MAX processes as optional.

All MasterMig device models have a 4-roll wire feed mechanism with the maximum wire spool diameter of 300 mm.

For the MasterMig device part descriptions, refer to "MasterMig device" on the next page.

MasterMig control panels

- Color LCD display

MasterMig cooling units

- MasterMig Cooler
- MasterMig Cooler M (multi-voltage).

For the cooling unit part descriptions, refer to "MasterMig Cooler cooling unit (optional)" on page 10.

MIG welding guns

- Flexlite GX welding guns with euro connector.

For more information on the Flexlite GX welding guns, refer to [Kemppi Userdoc](#).

Subfeeders

-  *Subfeeder support can be added with a separate installation kit (contact your Kemppi dealer / service workshop for more information).*

- SuperSnake GTX subfeeder.

For more information on the SuperSnake GTX subfeeder, refer to [Kemppi Userdoc](#).


Optional accessories

- 4-wheel carts
- 2-wheel carts
- Remote control HR40 (2-knob control)
- Remote control HR43 (1-knob control)
- Power source air filter
- Wire feed cabinet heater.

For more information on optional accessories, contact your local Kemppi dealer.


1.2 MasterMig device

Front

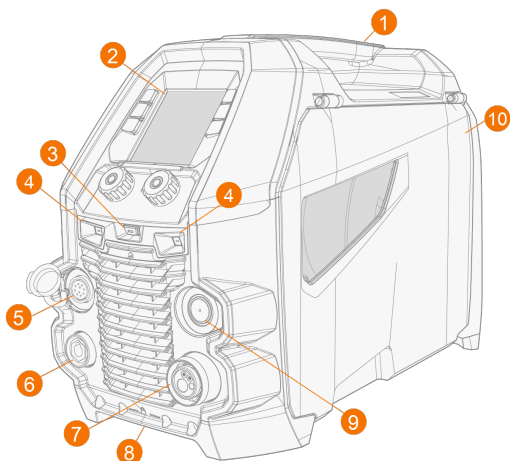

1. Transportation handle (also for mechanical lifting when the device is not installed on a cooling unit or cart)
2. Control panel
3. Work lights ON/OFF
4. Work light
5. Control cable connector
6. Earth return cable connector
7. Welding cable euro connector
8. Front locking interface
 >> For locking on top of the cooling unit or on the cart
9. Connector for subfeeder synchronization kit (optional)
10. Wire feed cabinet hatch.


Rear

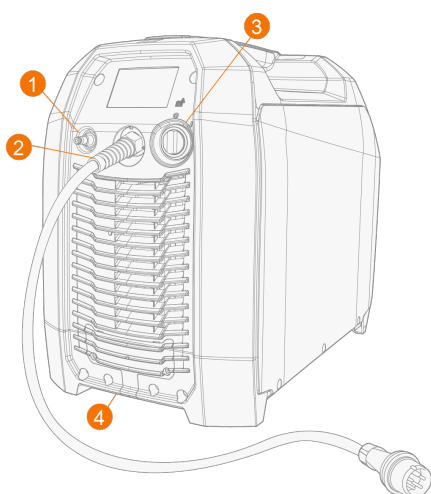

1. Shielding gas hose connector
2. Mains cable


3. Power switch
4. Rear locking interface
 - >> For locking on top of the cooling unit or on the cart.

Inside wire feed cabinet

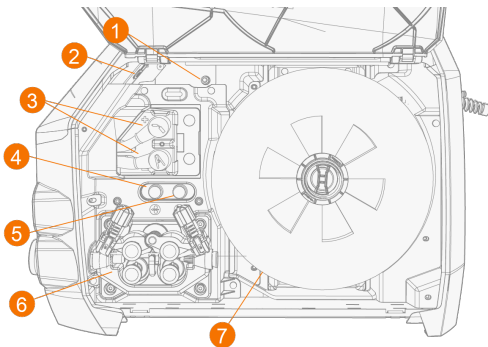

1. Gas regulating valve (MasterMig 355)
 - >> For setting the gas flow rate in the device lower than the gas flow rate from the gas supply
2. USB connector
3. Polarity terminals
4. Wire inch button
 - >> Drive the filler wire forward (with arc off)
5. Gas test button
 - >> Test the shielding gas flow and flush the gas line
6. Wire feed mechanism (refer to "Wire feed mechanism" below)
7. Wire spool.

1.2.1 Wire feed mechanism

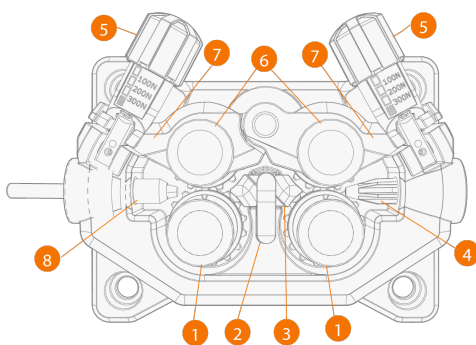


1. Drive rolls and drive roll mounting caps
2. Middle guide tube locking clip
3. Middle guide tube
4. Inlet guide tube
5. Pressure handles
6. Pressure rolls and pressure roll mounting pins
7. Pressure roll locking arms
8. Outlet guide tube.

For replacing the feed rolls, refer to "Installing and replacing feed rolls" on page 25.

For replacing the wire guide tubes, refer to "Installing and replacing wire guide tubes" on page 27.


1.3 MasterMig Cooler cooling unit (optional)

Front

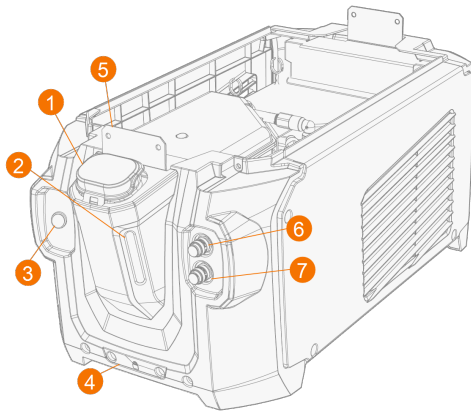




1. Cooler container cap
2. Cooling liquid level indicator
3. Cooling liquid circulation button
 >> Keeping the button pressed activates the pump and circulates the cooling liquid throughout the system. Once released, the pump stops.
4. Front locking interface
 >> For locking on the cart
5. Front locking interface
 >> For locking to the power source
6. Coolant inlet connector (red)
7. Coolant outlet connector (blue).

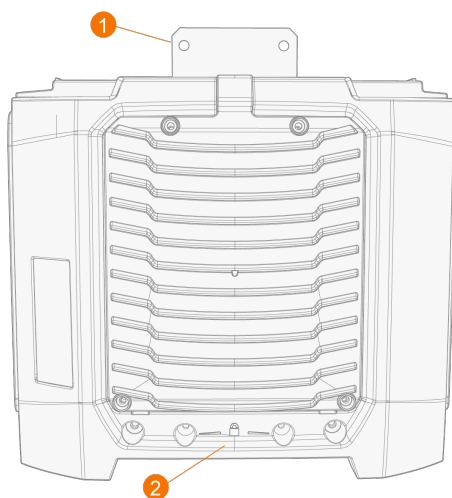Rear



1. Rear locking interface
 >> For locking to the power source
2. Rear locking interface
 >> For locking on the cart.



2. INSTALLATION

-  *Do not connect the equipment to the mains before the installation is complete.*
-  *Do not modify the welding equipment in any way, except for the changes and adjustments covered in the manufacturer's instructions.*
-  *Place the machine on a horizontal, stable and clean ground. Protect the machine from rain and direct sunshine. Check that there is enough space for cooling air circulation in the machine vicinity.*


Before installation

- Make sure to acknowledge and follow the local and national requirements regarding installation and use of high voltage units.
- Check the contents of the packages and make sure the parts are not damaged.
- Before you install the power source on site, see the requirements for the mains cable type and fuse rating.

Distribution network

-  *This Class A equipment is not intended for use in residential locations where the electrical power is provided by the public low-voltage supply system. There can be potential difficulties in ensuring electromagnetic compatibility in those locations, due to conducted as well as radiated radio-frequency disturbances.*
-  *MasterMig power source 350A: Provided that the short circuit power of public low voltage system at the point of common coupling is higher than 2.4 MVA, this equipment is compliant with IEC 61000-3-11:2017 and IEC 61000-3-12:2011 and can be connected to public low voltage systems. It is the responsibility of the installer or user of the equipment to ensure, by consultation with the distribution network operator if necessary, that the system impedance complies with the impedance restrictions.*

2.1 Installing power source mains plug

 *Only an authorized electrician is allowed to install the mains cable and plug.*

 *Do not connect the machine to the mains before the installation is complete.*

Install the 3-phase plug according to the MasterMig device and site requirements.


The mains cable includes the following wires:

1. Brown: L1
2. Black: L2
3. Grey: L3
4. Yellow-green: Protective earth

Cable type and fuse rating requirements:

Unit amperage	Cable type	Fuse rating
350 A (380-460 V)	4 mm ²	16 A
350 A (380-460 / 220-230 V)	4 mm ²	16 / 32 A


2.2 Installing cooling unit (optional)

 *The MasterMig cooling unit must be installed by authorized service personnel.*

Tools needed:




1. Remove the small connector cover in the rear of the power source.

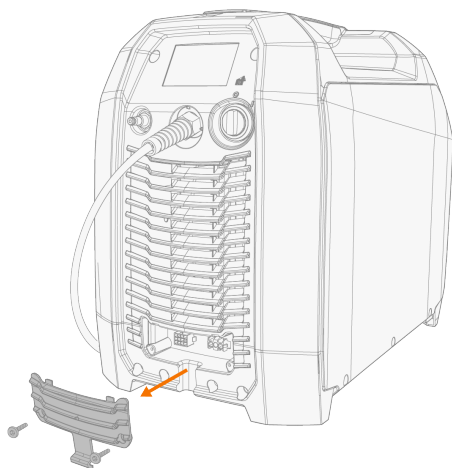


2. Route the cooling unit's connection cables so that they remain accessible through the next steps.
3. Lift the MasterMig device on top of the cooling unit so that the fixing plates align and go into their slots.

 *Ensure that the cooling unit's connection cables are not caught and/or damaged between the edges.*

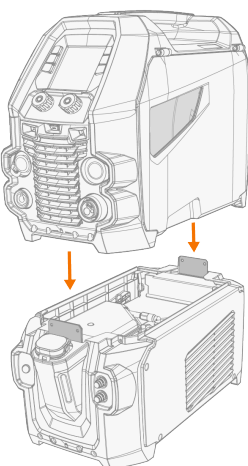

4. Fix the units together with two screws (M5x12) in the front and two screws (M5x12) in the rear.
5. Connect the cooling unit cables.

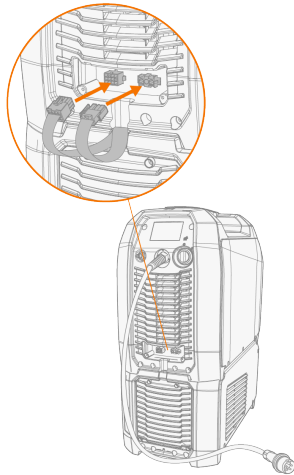

6. Replace the small connector cover.

2.3 Installing equipment on cart (optional)


MasterMig has four transport unit options: a 4-wheel cart with a gas bottle rack (P45MT), a 4-wheel cart without a gas bottle rack (P43MT), a 2-wheel cart with a gas bottle rack (T25MT) and a 2-wheel cart without a gas bottle rack (T35A).

 *The equipment installation principle and the bottom securing interface is the same with all carts.*

Tools needed:





1. Install the cooling unit on the cart.

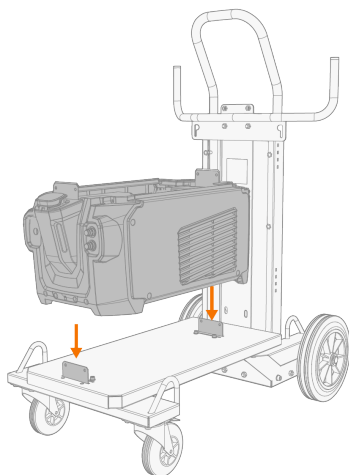


2. Fix the cooling unit to the cart with two screws (M5x12) in the front and two screws (M5x12) in the rear.
3. Install the MasterMig device on top of the cooling unit. Refer to "Installing cooling unit (optional)" on page 13 for installation details.
4. T25MT 2-wheel cart: Secure the equipment to the cart with the two side connection brackets.

 *With the T25MT cart, an additional securing bracket is attached to the device handle. Secure the bracket to the cart with the screws provided (M8x16).*

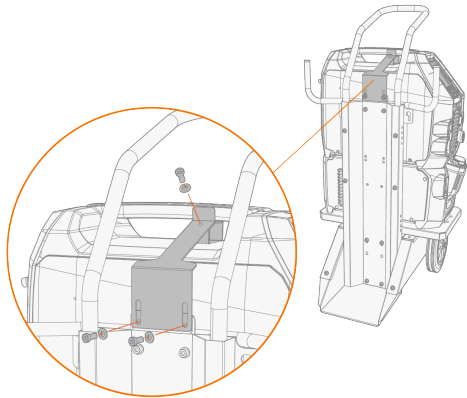

 **T35A 2-wheel cart:** The cart must be in horizontal position during welding.

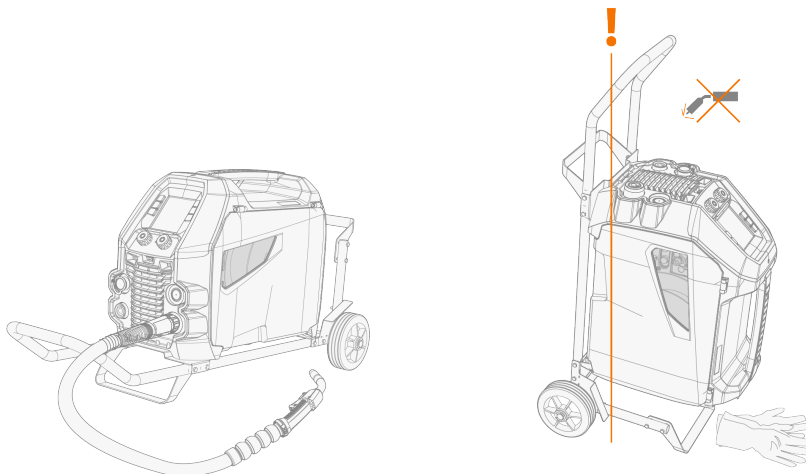


For lifting the MasterMig equipment, refer to "Lifting MasterMig equipment" on page 52.

2.4 Connecting welding gun

MasterMig is designed to be used with the Kemppi Flexlite GX welding guns. For the Flexlite GX operating instructions, refer to userdoc.kemppi.com.

 Always check that the wire liner, contact tip and gas nozzle are suitable for the job.


1. Push the welding gun connector into the euro connector and hand-tighten the collar.
2. If your setup includes a water-cooled gun, connect the cooling liquid hoses to the cooling unit. The hoses are color-coded.

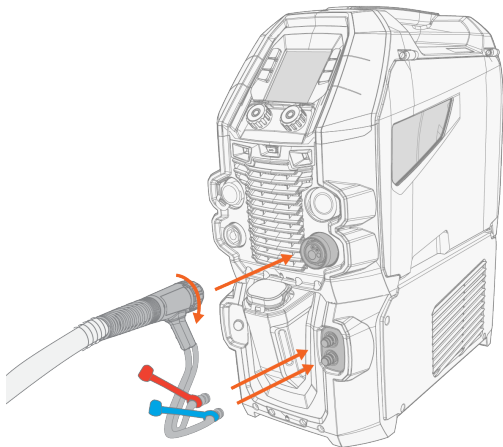

3. Install and load the filler wire as described in "Installing and changing wire" on page 20.
4. Check the gas flow. Refer to "Installing gas bottle and testing gas flow" on page 28 for more information.

2.5 Connecting earth return cable

Connect the earth return cable to the welding machine.

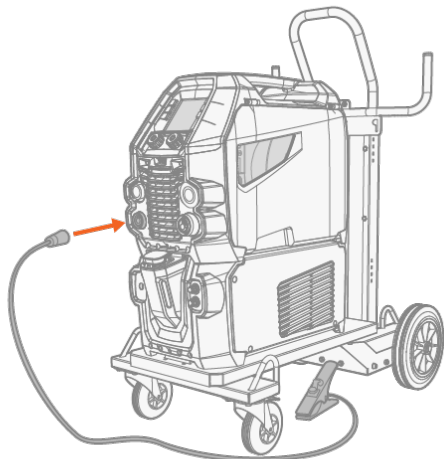


2.6 Installing remote control (optional)

Remote controls are optional. To enable remote operation, connect the remote control device to the MasterMig welding equipment. The remote control mode can be set and adjusted in the control panel settings ("Control panel: System settings" on page 42).

Remote control HR43/HR40

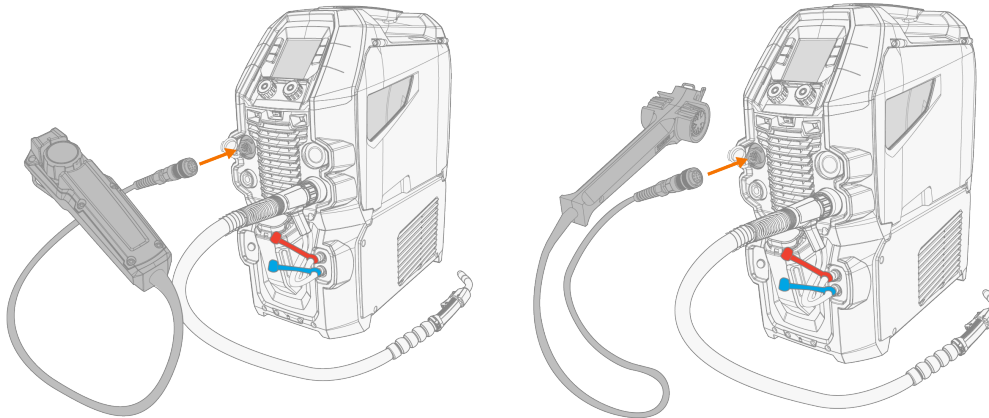

1. Connect the remote control cable to the control cable connector.



2. Adjust the remote control parameters in the control panel settings.


2.7 Installing and changing wire

Always ensure that the feed rolls are suitable for the filler wire (diameter and material) in question. For more information, refer to "Wire feeder consumables" on page 70.


-  *Install the welding gun to the MasterMig device before installing the wire spool.*
-  *When changing the wire spool, remove the remaining filler wire from the welding gun and wire feed mechanism before removing the wire spool.*


To remove the wire spool:

1. Open the wire feed cabinet hatch.
2. Loosen and remove the spool fastener and remove the wire spool.

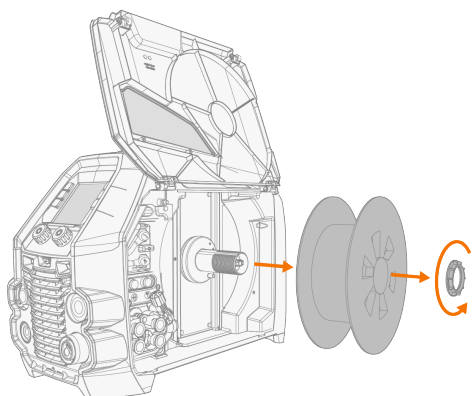


To install a new wire spool:

1. Insert the wire spool onto the spool hub. Secure the wire spool in place by inserting and tightening the spool fastener.
-  *Ensure that the wire spool is facing the right direction, the filler wire running from the bottom of the spool to the feed rolls.*

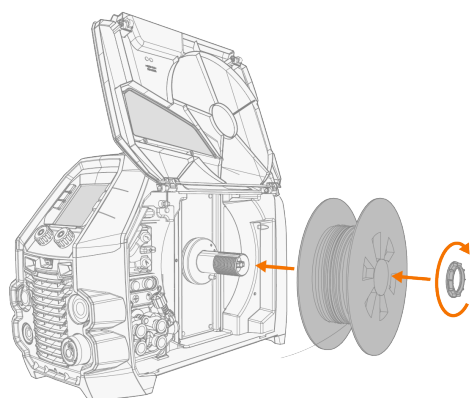

2. If needed, adjust the spool brake by turning the spool brake tightening knob in the center of the spool hub.

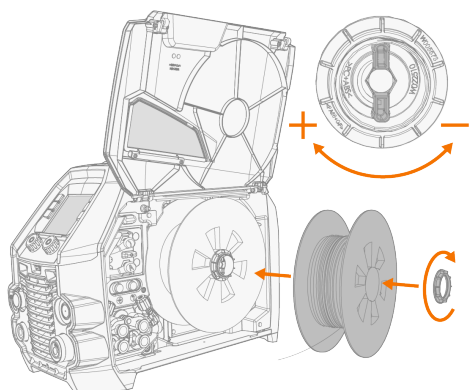


To install the filler wire:

1. Release the filler wire end from the spool and cut off any deformed section so that the end is straight.


 *Ensure that the filler wire does not spill from the spool when it is released.*

2. File the tip of the filler wire smooth.

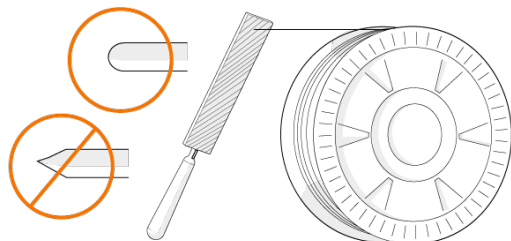


 *Sharp edges on the filler wire tip may damage the wire liner.*


3. Release the pressure arms to move the feed rolls apart.

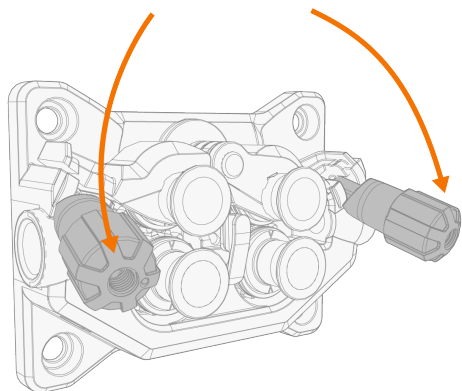


4. Guide the filler wire through the inlet guide tube (a), middle guide tube (b) and into the outlet guide tube (c), which feeds the filler wire to the welding gun.

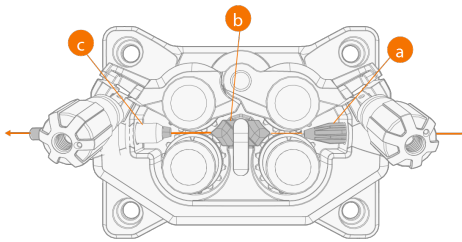


5. Push the filler wire by hand into the gun so that the wire reaches the wire liner.

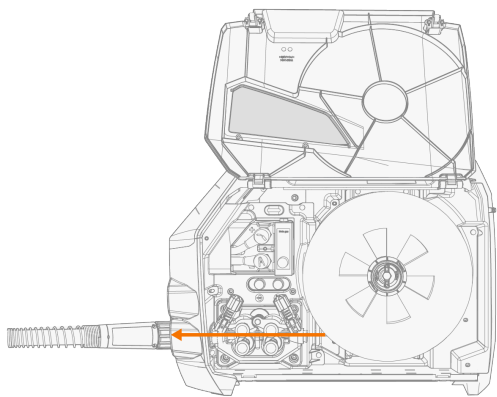

6. Close the pressure arms so that the filler wire is locked between the feed rolls.

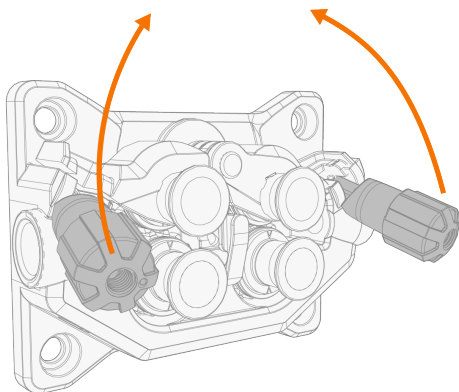


- Adjust the pressure of the feed rolls with the pressure adjustment wheels. The pressure is the same for both feed roll pairs.

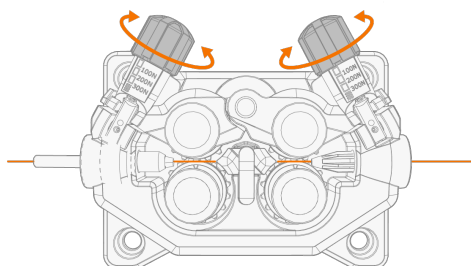


The graduated scales on the pressure handle indicate the pressure applied to the feed rolls. Adjust the pressure of the feed rolls according to the table below.

Filler wire material	Feed roll profile*	Filler wire diameter (mm)	Adjustment (x100N)
Fe/Ss solid	V-groove	0.8-1.0	1.5-2.0
		≥ 1.2	2.0-2.5
MC/FC	V-groove, knurled	≥ 1.2	1.0-2.0
Al	U-groove	1.0	0.5-1.0
		1.2	1.0-1.5

 Excessive pressure flattens the filler wire and may damage coated or cored filler wires. Excessive pressure also unnecessarily wears the feed rolls and increases gearbox load.

- Press the wire inch button (*) to drive the filler wire into the welding gun. Stop when the wire reaches the welding gun's contact tip. The wire feed speed can be adjusted in the control panel.

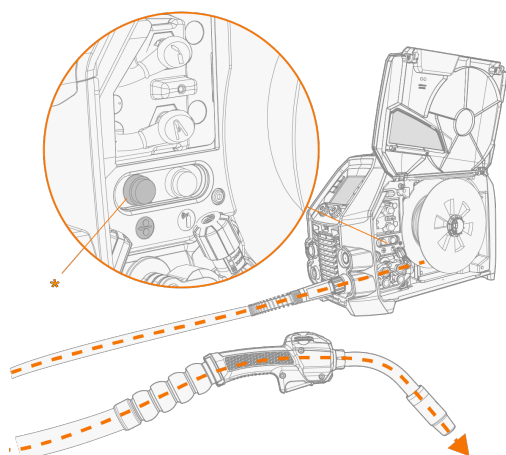

 Watch out for the wire when it reaches the contact tip and exits the gun.

9. Before welding, ensure that the welding parameters and settings conform to your welding setup.


** Feed roll profiles and corresponding symbols*

Feed roll profile	Symbol
V-groove	V
V-groove, knurled	V≡
U-groove	U


2.8 Installing and replacing feed rolls

Replace the feed rolls when the filler wire diameter or material changes. Select the feed rolls according to the tables in "Wire feeder consumables" on page 70.


1. Open the wire feed cabinet hatch.
2. Release the pressure handles on the wire feed mechanism.

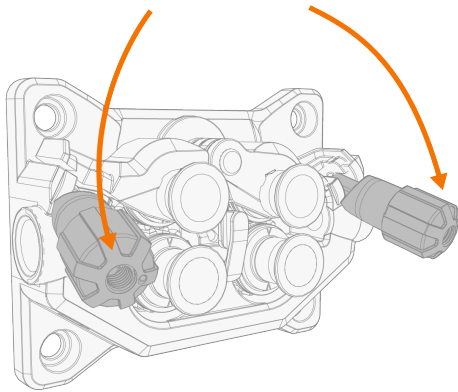

3. Open the locking arms to release the feed rolls.

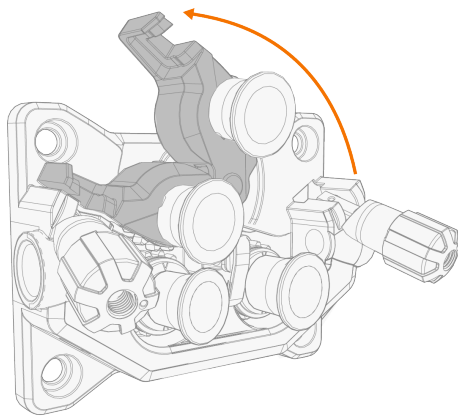


4. Pull the pressure roll mounting pins and drive roll mounting caps off.

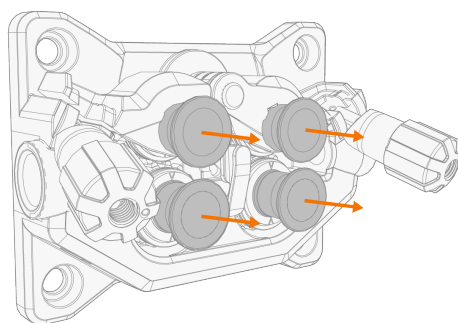

i The pressure rolls' mounting pins have central axles attached to them, whereas the drive rolls' central axles act as drive shafts attached directly to the wire feed mechanism/motor.

5. Remove the drive rolls and pressure rolls.

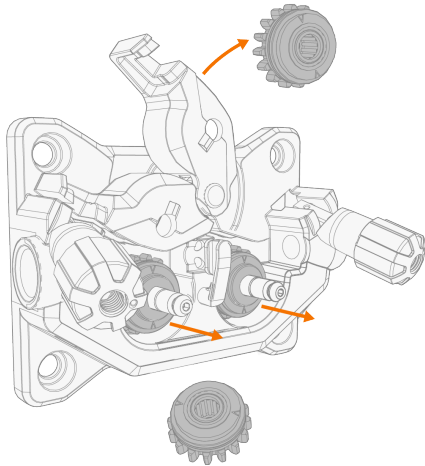


6. Follow the previous steps in reverse to install the wire feed rolls. Align the cut on the drive rolls' bottom with the pin on the drive shaft.
7. Reattach the mounting caps and mounting pins to lock the drive and pressure rolls into their places.
8. Close the locking arms and lower the pressure handles on the feed rolls. Refer to "Installing and changing wire" on page 20 for more information on the wire installation.
9. Close the wire feed cabinet hatch.

2.9 Installing and replacing wire guide tubes

The wire feed mechanism includes three wire guide tubes. Replace them when the filler wire diameter or material changes. Select the wire guide tubes according to the tables in "Wire feeder consumables" on page 70.


 *When replacing the outlet guide tube, the welding gun must be detached.*

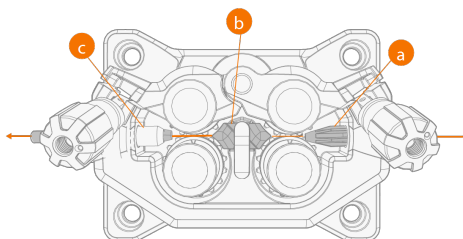

- a. Inlet guide tube
- b. Middle guide tube
- c. Outlet guide tube




To replace the wire guide tubes:

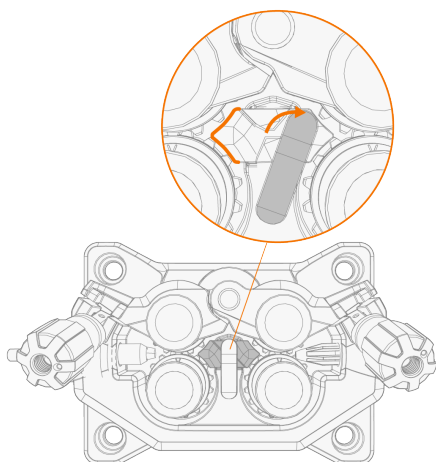1. Release the pressure arms and remove the filler wire from the system.
2. Pull out the inlet guide tube (a) and insert a new one in its place.
3. Turn the locking clip aside to free the middle guide tube (b) for replacement.
4. Insert a new middle guide tube in its slot and push it properly in place. Ensure that the mark arrow points to the wire running direction.




5. Turn the locking clip back to lock down the new middle tube.
6. Replace the outlet guide tube (c) by pushing the old outlet tube out from either direction.

2.10 Installing gas bottle and testing gas flow


-  *Handle gas bottles with care. There is a risk of injury if the gas bottle or the bottle valve is damaged!*
-  *Always secure the gas bottle properly in an upright position to a special holder on the wall or on the welding equipment cart. Always keep the gas bottle valve closed when not welding.*
-  *- If a transport unit with a gas bottle rack is used, install the gas bottle on the transport unit first, then make the connections.*
 - Install the welding gun to the welding device before installing and testing the gas bottle.*
 - Do not use the whole contents of the bottle.*

Contact your local Kemppi dealer for choosing the gas and the equipment.


- 1.** Without gas bottle cart: Place the gas bottle in a suitable, secure location.
- 2.** With gas bottle cart: Move the gas bottle on the transport unit's gas bottle rack and secure it in place with the straps and fixing points provided.

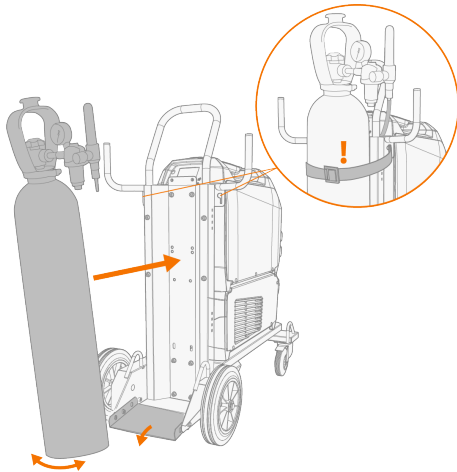

- 3.** If not already, connect the welding gun to the welding device (refer to "Connecting welding gun" on page 17).
- 4.** Connect the gas hose to the welding device.

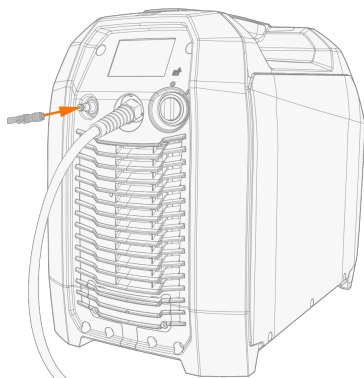

5. Open the gas bottle valve.
6. Press the gas test button (a) to test and adjust the gas flow. Use the gas regulating valve (b) (in MasterMig 355 only) or an external flow meter and regulator.

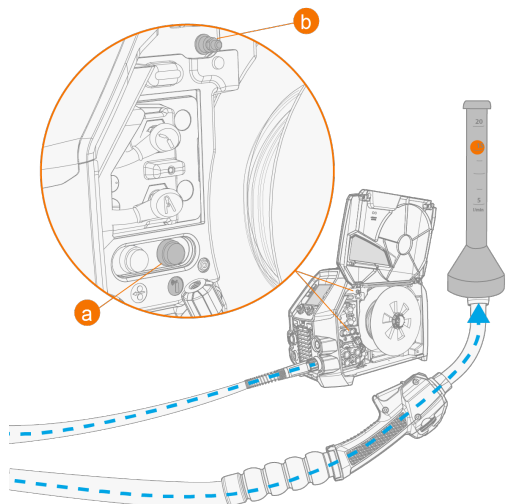

 The gas test time is 20 seconds by default. The gas test time can be changed in the control panel.

Recommended gas flow rates (for general guidance only):






	TIG*	MIG**
Argon	5...15 l/min	10...25 l/min
Helium	15...30 l/min	-
Argon + 18-25% CO ₂	-	10...25 l/min
CO ₂	-	10...25 l/min

* Depending on the gas nozzle size.

** Depending on the gas nozzle size and welding current.

3. OPERATION

Before using the equipment, ensure that all the necessary installation actions have been completed according to your equipment setup and instructions.

-  *Welding is forbidden in places where there is an immediate fire or explosion hazard!*
-  *The wire feed cabinet hatch must be kept closed when welding.*
-  *Check that there is enough space for cooling air circulation in the machine vicinity.*
-  *If the welding equipment is left unused for a longer period, disconnect the mains plug from the mains.*
-  *Always check before use that shielding gas hose, earth return cable and clamp and mains cable are in serviceable condition. Ensure that the connectors are correctly fastened. Loose connectors can impair welding performance and damage connectors.*


3.1 Preparing welding system for use

Before starting the use of the welding equipment:

- Ensure the installation has been completed
- Switch the welding equipment on
- Prepare the cooler
- Connect the earth return cable
- Calibrate the welding cable (in MIG operation mode only)
 - >> Refer to "Calibrating welding cable" on page 33 for instructions.

Turning on welding system

To turn on the welding equipment, turn the power source main switch to ON (I).

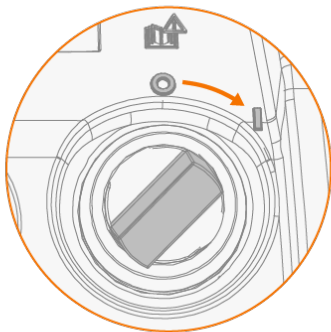

Turn the main switch to start and shut down the welding equipment. Do not use the mains plug as a switch.

 *If the welder is left unused for a longer period, detach the mains plug to disconnect it from the mains.*

Preparing cooler

Fill the coolant container inside the cooler with Kemppi cooling liquid. For instructions on filling the cooler, refer to "Filling cooler and circulating coolant" below. To weld, you must pump the coolant through the system by pressing the coolant circulation button in the front panel of the cooling unit.

Connecting earth return cable

 *Keep the work piece connected to earth to reduce the risk of injury to users or damage to electrical equipment.*


Attach the earth return cable clamp on the work piece.

Ensure that the contact surface is clean of metal oxide and paint and that the clamp is firmly secured.

3.1.1 Filling cooler and circulating coolant

Fill the cooler with 20-40 % coolant solution, for example, Kemppi cooling liquid.

1. Open the cooler cap.
2. Fill the cooler with coolant. Do not fill over the max. marking.

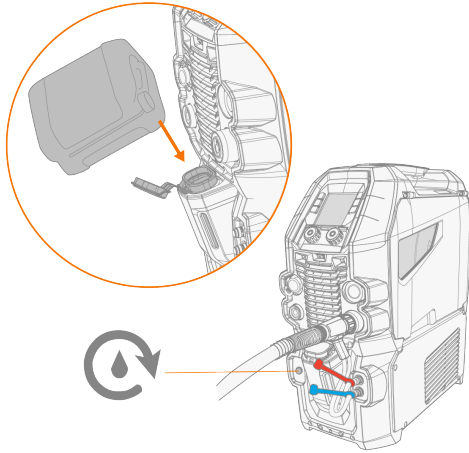

3. Close the cooler cap.

To circulate the coolant:


Press the coolant circulation button in the cooler front panel. It activates the motor, which pumps the coolant to the hoses and to the welding gun.

Complete the coolant circulation operation after each time you change the welding gun.

3.2 Calibrating welding cable

The welding cable resistance can be measured using the built-in cable calibration function without an additional measurement cable. This calibration function is available only in MIG operation mode.

1. Connect the earth return cable between the welding device and work piece.
2. Remove the welding gun gas nozzle.
3. Connect the welding gun to the welding device.
4. Turn the welding device on.
5. On the control panel, go to settings and enable cable calibration.
6. Touch the cleaned work piece briefly with the welding gun contact tip.

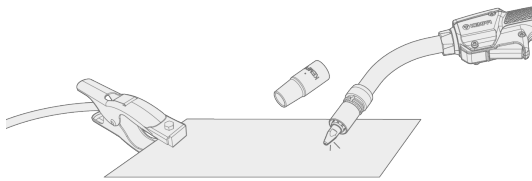


i *There is no need to press the trigger. Trigger function is disabled at this stage.*

7. Using the control panel, confirm the measured values.

3.3 Using control panel

The MasterMig control panel includes features and functions for MIG welding with the options to use MasterMig also for TIG and MMA welding.

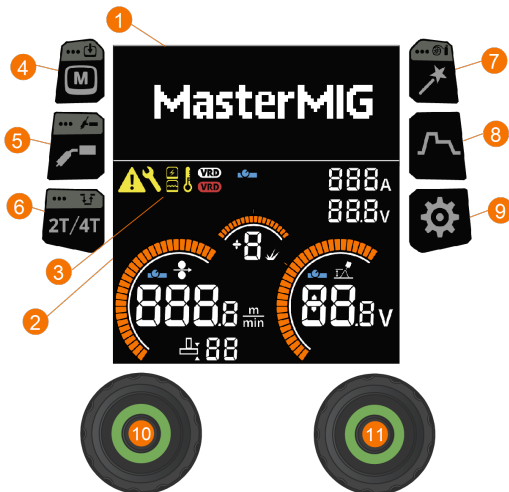









General

1. Settings display
2. Welding display
3. Indicators (for descriptions of the symbols, refer to the Indicators table below)
4. Memory channels button (MIG only)
 - >> Shortcut to the memory channel selection
 - >> Long-press (> 1 second) opens a dialog for saving changed welding parameters to a memory channel
 - >> Memory channel selection is not available with TIG and MMA welding processes as there is one memory channel for each process
5. Welding process / operation mode button
 - >> Shortcut to welding process selection
 - >> Long-press (> 1 second) in MIG mode opens a dialog for switching between MIG / TIG / MMA modes
6. Trigger logic button
 - >> Switches between 2T and 4T trigger logic
 - >> Long-press (> 1 second) opens the Powerlog settings (4T only)
7. Weld Assist button
 - >> Shortcut to Weld Assist
 - >> Long-press (> 1 second) opens the filler wire and shielding gas settings adjustment
8. Welding parameters button
 - >> Shortcut to the welding parameters view
9. Settings button
 - >> Shortcut to the system settings view
10. Left control knob
 - >> Adjustment and selection
11. Right control knob
 - >> Adjustment and selection.

Indicators

Symbol	Description
--------	-------------

	General notification There is a problem that requires attention.
	Service / repair
	Power source
	Cooling unit
	High temperature indicator (overheating)
 	VRD (Voltage Reduction Device): White and red VRD symbols are off = VRD is off White VRD symbol is on = VRD is on Red VRD symbol is blinking = There is a fault with VRD that prevents welding.
	Remote mode (ON/OFF)

Views

- A. [Main view](#)
- B. [Memory channels](#)
- C. [Welding processes](#)
- D. [Welding parameters](#)
- E. [Trigger logic](#)
- F. [Weld Assist](#)
- G. [Weld data](#)
- H. [System settings](#)

3.3.1 Control panel: Main view

The MasterMig control panel's main view consists of the settings display and welding display. The content displayed depends on the welding process and features and functions used.



1. Memory channel (and filler wire and shielding gas settings, if set)
2. Active welding process
3. Applied welding functions*
4. Applied trigger logic function
5. Wire feed speed
 >> The value range is defined by the active welding program, step 0.1, default = 5.0 m/min
6. Current and voltage
7. Dynamics
 >> Controls the short circuit behavior of the arc. The lower the value the softer the arc, the higher the value the rougher the arc. Value range: -9 ... +9, default = 0
 >> With MAX process a corresponding MAX parameter adjustment is displayed
8. Welding voltage
 >> With 1-MIG process voltage fine tuning is displayed
 >> With MAX process a corresponding MAX parameter adjustment is displayed.

Control knob functions

 

Left control knob:

- Manual MIG: Wire feed speed adjustment
- 1-MIG: Wire feed speed adjustment
- Pulse MIG: Wire feed speed adjustment
- DPulse MIG: Wire feed speed adjustment and switching between pulse levels with the control knob button
- TIG/MMA: Welding current adjustment.

Right control knob:

- Manual MIG: Welding voltage and dynamics adjustment
- 1-MIG: Dynamics adjustment and fine tuning of welding voltage and switching between the adjustments with the control knob button
- Pulse MIG: Fine tuning of welding voltage
- DPulse MIG: Fine tuning of welding voltage
- MMA: Dynamics adjustment.

*Applied welding functions


Graph	Description
	Hot start, Powerlog and crater fill OFF.
	Hot start and crater fill ON.



Hot start, Powerlog (power levels) and crater fill ON.

3.3.2 Control panel: Memory channels

There are 6 memory channels available in MIG welding.

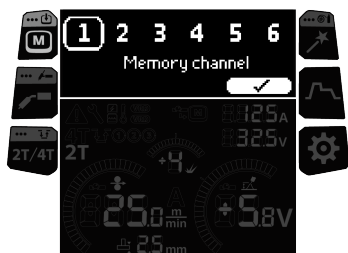

Selecting memory channel

1. Turn the right control knob to highlight the desired memory channel.
2. Press the right control knob to select the memory channel.

Saving changes to memory channel

1. Adjust welding parameters.
2. Long-press the memory channel button.
3. The channel number framed by a dashed line indicates that the set welding parameters are different from the ones currently saved on the active memory channel:




4. Save the changes to the active memory channel by pressing the right control knob or select another channel by turning the right control knob.

3.3.3 Control panel: Welding process

Welding process is selected in the Welding process view. For more information on welding processes, refer to "Additional guidance to functions and features" on page 45.

The use of pulse and MAX processes is possible in MasterMig 355.

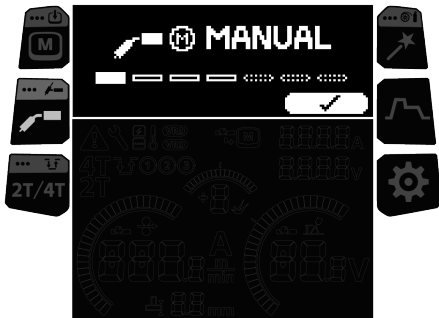

Selecting welding process

1. Turn the right control knob to highlight the desired welding process.

i Only a welding process that supports the set filler wire and shielding gas combination can be selected. If the filler wire and shielding gas settings have not been made, then only manual MIG process is available. The filler wire and shielding gas settings can be changed at any time by long-pressing the Weld Assist button.

2. Press the right control knob to confirm selection.

3.3.4 Control panel: Trigger logic

Welding guns can have several alternative trigger operation modes (trigger logics). Most common are 2T and 4T. In 2T mode you hold the trigger down while welding. In 4T mode you press and release the trigger to start or to stop welding. For more information on trigger logic, refer to "Trigger logic functions" on page 47.


Switching between 2T and 4T trigger logic

1. Press the [trigger logic button](#).

Selecting Powerlog (4T only)

Powerlog is not available with DPulse or MAX processes.

1. Long-press the [trigger logic button](#).
2. Choose whether 2 or 3 power levels are used by turning and pressing the right control knob.

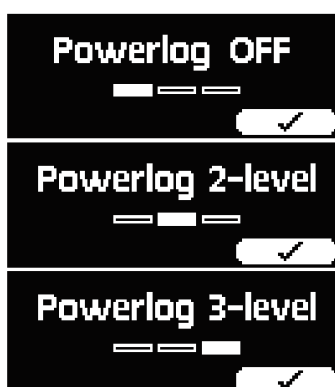


3. In the main view, set up the wire feed speed, fine tuning of welding voltage and dynamics for each level.
 - >> To switch between the voltage fine tuning and dynamics adjustments, press the right control knob.
 - >> To switch between power levels, press the left control knob.

Tip: To turn off Powerlog and activate the 2T trigger logic, press the trigger logic button.

3.3.5 Control panel: Weld Assist

Weld Assist is a wizard-like utility for easy selection of welding parameters. The utility walks the user step-by-step through the selection of required parameters, presenting the selections in an easily understandable way. In Weld Assist, the selections are made with the two control knobs.

Weld Assist is available for MIG welding.

 The currently selected filler wire and shielding gas information is shown and used as a basis in Weld Assist. If necessary, the filler wire and shielding gas settings can be changed by long-pressing the Weld Assist button.

1. Press the Weld Assist button and select **Start**.



2. Select:


>> Material thickness (1...10 mm). (With PG position, the maximum material thickness is 3 mm.)



>> Joint type: butt joint / corner joint / edge joint / lap joint / T-joint / tube joint / tube+plate joint.



>> Position: PA / PB / PC / PD / PE / PF / PG.

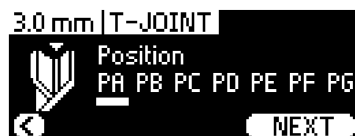


3. Weld Assist gives you a recommendation for these welding parameters:
 - >> Wire feed speed
 - >> Current
 - >> Voltage
4. Confirm the Weld Assist's recommendation for welding parameters by saving the parameter values to a memory channel.

Tip: You can go back step by step in Weld Assist by pressing the left control knob.

Once the recommended values are saved, they are automatically applied. The welding parameters created with Weld Assist are still adjustable as per normal.

3.3.6 Control panel: Welding parameters

Welding parameters are welding process specific and are visible and available for adjustment accordingly. The welding process selection is based on the active memory channel and its settings.

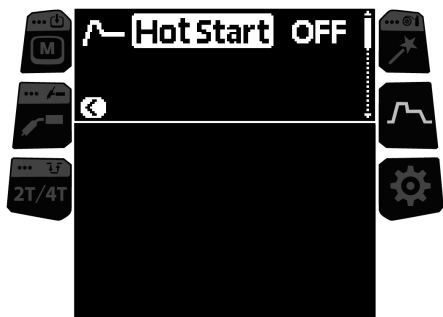

Adjusting welding parameters

1. Turn the right control knob to highlight the desired welding parameter.
2. Press the right control knob to select the welding parameter for adjustment.
3. Turn the right control knob to adjust the welding parameter value.
 - >> >> Depending on the parameter to be adjusted, refer also to the Welding parameters table below for more details.

4. Confirm the new value / selection by pressing the right control knob.

Welding parameters

Manual MIG welding parameters

The parameters listed here are available for adjustment only with the manual MIG process.

Parameter	Parameter value	Description
Post current	-30 ... +30 Default = 0	Post current setting affects the wire length at the weld end, for example to prevent the wire from stopping too close to the weld pool. This also enables the optimum wire length for the start of the next weld.

1-MIG welding parameters

The parameters listed here are available for adjustment with the 1-MIG process.

Parameter	Parameter value	Description
Hot start	ON/OFF Default = OFF	Welding function that uses higher or lower wire feed speed and welding current at the start of the weld. After the Hot start period the current changes to normal welding current level. This facilitates the start of the weld especially with aluminum materials. The Hot start level and time (only in 2T trigger mode) are preset by the user.
- Hot start level	-40 ... +100 %, step 1 Default = +40 %	
- Hot start time	0.1 ... 10.0 s, step 0.1 Default = 1.2 s	
Crater fill	ON/OFF Default = OFF	When welding with high power, a crater is usually formed at the end of the weld. The Crater fill function decreases the welding power / wire feed speed at the end of the welding job so that the crater can be filled using a lower power level. Crater fill duration, wire feed speed and voltage are preset by the user. The crater fill start level cannot be smaller than the crater fill end level. When the 4T timer is set to ON, releasing the trigger during crater fill does not end welding.
- Crater fill start level	10 ... 150 %, step 1 Default = 100 %	
- Crater fill time	0.1 ... 10.0 s, step 0.1 Default = 1.0 s	
- Crater fill end level	10 ... 150 %, step 1 Default = 10 %	
- 4T timer	ON/OFF	
Touch Sense Ignition	OFF/ON Default = OFF	Touch Sense Ignition (TSI) delivers minimum spatter and stabilizes the arc immediately after ignition.
WiseFusion	OFF/ON Default = OFF	The WiseFusion feature enables adaptive arc length control, which keeps the arc optimally short and focused. For more information, refer to "WiseFusion feature" on page 48.
Post current	-30 ... +30 Default = 0	Post current setting affects the wire length at the weld end, for example to prevent the wire from stopping too close to the weld pool. This also enables the optimum wire length for the start of the next weld.

Pulse / DPulse / MAX Position welding parameters (MasterMig 355 only)

The parameters listed here are available for adjustment with the pulse and MAX Position welding processes in addition to the MIG and 1-MIG welding parameters. For more information on the processes, refer to "Additional guidance to functions and features" on page 45.

Parameter	Parameter value	Description
Pulse current		The pulse current relative to the base current in pulse and double pulse welding.
- Level	-10 ... 15 % Default = 0 %	
DPulse		This adjusts the double pulse frequency and time percentage. The pulse ratio adjusts the first pulse level. When the pulse ratio is set at 35 %, the ratio of the second pulse level is 65 %. Note: The wire feed speed and voltage fine tuning are adjusted in the main view.
- Frequency	0.4 ... 8.0 Hz Default = 2 Hz	
- Pulse ratio	10 ... 90 % Default = 35 %	
MAX Position		This adjusts the MAX Position frequency.
- Frequency	-0.5 ... 0.5 Hz Default = 0 Hz	

3.3.7 Control panel: System settings



Changing settings

1. Turn the right control knob to highlight the desired settings parameter.
2. Press the right control knob to select the settings parameter for adjustment.
3. Turn the right control knob to select the settings value.
>> Depending on the settings parameter to be adjusted, refer also to the Settings table below for more details.
4. Confirm the new value / selection by pressing the right control knob.

Settings

Parameter	Parameter value	Description
Remote control	ON/OFF Default = OFF	Select whether remote is used.
Remote selection	Hand remote / Gun remote Default = Hand remote	
Remote mode	Wire feed speed / Channel Default = Wire feed speed	This determines what is changed with the remote, wire feed speed or memory channel (available channels: 1...5).

Remote min.	Defined by the active welding program	Minimum and maximum limits for the remote wire feed speed adjustment.
Remote max.	Defined by the active welding program	
Cable calibration (MIG only)	Start/Cancel	Calibration information on the previous calibration is also shown. Refer to "Calibrating welding cable" on page 33 for cable calibration.
Water cooler	OFF/Auto/ON Default = Auto	When ON is selected, the coolant is circulated continually, and when Auto is selected, the coolant is circulated only during welding.
Cycle timer	ON/OFF Default = OFF	A welding function that automatically produces a weld of a predefined duration.
- Time	0.0 ... 60.0 s Default = 2.0 s	
WF end step	OFF/ON Default = OFF	Wire feed end step feature prevents the filler wire from sticking to the contact tip when the welding ends.
Subfeeder	<i>Subfeeder model</i> / OFF Default = OFF	If a compatible subfeeder is connected, select the subfeeder from the list. Compatible subfeeders: <i>SuperSnake GTX 10 m, 15 m, 20 m, 25 m.</i> Note: For the best possible welding result when using the pulse and MAX welding processes with a subfeeder device, we recommend a maximum subfeeder cable length of 10 meters (SuperSnake GTX 10 m). This recommendation assumes that you are using a 5-meter welding gun cable and a 15-meter earth return cable together with the subfeeder. In some cases, it is possible to weld with pulse and MAX welding processes with a 15-meter subfeeder device, but a test weld is advised.
Arc verification	1...365 Default = 0 (OFF)	This defines the number of days to the next device verification.
Weld data	0...10 s, step 1 Default = 5 s	This defines how long the weld data summary is shown after each weld.
Safe wire inch (MIG only)	OFF/ON Default = ON	When ON, and the arc doesn't ignite, the filler wire is fed 5 cm. When OFF, 5 m of filler wire is fed.
Gas guard (MasterMig 355 only)	ON/OFF Default = OFF	Gas guard prevents welding without shielding gas.
Voltage display	Arc voltage / Terminal voltage Default = Arc voltage	This defines which is shown on the control panel display, arc or terminal voltage.
PIN code	ON/OFF	4-digit PIN code for locking the control panel after 30 s of inactivity. PIN lock does not prevent welding, browsing Powerlog levels or selecting memory channel.
Device info		Shows information on the device and its usage.


Factory reset

Reset/Cancel
 Default = Cancel

Restores factory settings. Note that the arc verification parameter value is also reset.

3.3.8 Control panel: Weld data

After each weld, a weld summary is displayed briefly.

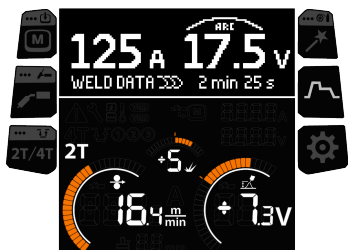

3.4 Additional guidance to functions and features

This section summarizes some of the MasterMig functions and features and how to use them.

3.4.1 1-MIG

1-MIG is a MIG/MAG welding process where the voltage is defined automatically when you adjust the wire feed speed. The voltage is calculated based on the welding program in use. The process is suitable for all materials, shielding gases and welding positions.

3.4.2 Pulse welding

Pulse welding is possible in MasterMig 355 only.

Pulse



Pulse is an automatic MIG/MAG welding process where the current is pulsed between the base current and the pulse current. The advantages of Pulse are a higher welding speed and deposition rate compared to short-arc welding, lower heat input compared to spray-arc welding, a spatter-free globular arc and smooth appearance of the weld. Pulse is suitable for all position welding. It is excellent for welding aluminum and stainless steel, especially when the material thickness is small.

- >> To take Pulse into use, press the [welding process button](#) and select Pulse.
- >> The corresponding pulse welding parameters become available for adjustment. For more information, refer to 'Pulse welding parameters' in [Control panel: Welding parameters](#).

DPulse



DPulse is a double-pulse MIG/MAG welding process with two separate power levels. The welding power varies between these two levels. The parameters of each level are controlled independently.

- >> To take DPulse into use, press the [welding process button](#) and select DPulse.
- >> Adjust wire feed speed and fine tuning in the [Main view](#).
- >> Adjust double pulse frequency and pulse ratio in the [Welding parameters view](#).

3.4.3 MAX Cool process

Available as an option in MasterMig 355.

MAX Cool is a short arc MIG/MAG welding process that is designed for root pass welds and sheet metal (thin sheet) applications. It's fully current-controlled welding process. MAX Cool does not require the use of a separate voltage sensing cable.

MAX Cool is suitable for all welding positions and provides a smooth arc, reducing spatter.

- >> To take MAX Cool into use, press the control panel's [welding process button](#) and select MAX Cool.
- >> To adjust the wire feed speed, in the [Main view](#), turn the left control knob. The adjustment's effect on the plate thickness is also shown.

>> To fine-tune the heat output, in the [Main view](#), turn the right control knob.

MAX Cool supports these filler wire and shielding gas combinations:

- Fe solid & Ar + 8...25 % CO₂ (1.0 mm, 1.2 mm)
- Fe solid & CO₂ (1.0 mm, 1.2 mm)
- Ss solid & Ar + 2 % CO₂ (1.0 mm, 1.2 mm)
- CuSi3 & Ar (1.0 mm)
- CuAl8 & Ar (1.0 mm).

3.4.4 MAX Position process

Available as an option in MasterMig 355.

MAX Position is a MIG/MAG welding process optimized for vertical fillet welds (position: PF). MAX Position automatically switches between two separate power levels. The two power levels can use the same welding process or two different welding processes.

>> To take MAX Position into use, press the control panel's [welding process button](#) and select MAX Position. The MAX Position frequency becomes available for adjustment in the [Welding parameters view](#). The ratio of the two power levels is preset.

>> To adjust the average wire feed speed, in the control panel's [Main view](#), turn the left control knob. The adjustment's effect on the base material thickness is also shown.

>> To fine-tune the welding voltage, in the control panel's [Main view](#), turn the right control knob.

MAX Position supports these filler wire and shielding gas combinations:

- Fe solid & Ar + 18% CO₂ (1.0 mm, 1.2 mm)
- Fe solid & Ar + 8% CO₂ (1.0 mm, 1.2 mm)
- Fe MC & Ar + 18% CO₂ (1.2 mm)
- Ss solid & Ar + 2% CO₂ (1.0 mm, 1.2 mm)
- AlMg & Ar (1.0 mm, 1.2 mm)

MAX Position supports these base material thicknesses:

- 3...12 mm.

3.4.5 MAX Speed process

Available as an option in MasterMig 355.

MAX Speed is a pulsed MIG/MAG welding process. It is designed to maximize the welding speed and to minimize the heat input by modifying the conventional MIG/MAG arcs.

MAX Speed is designed for steel and stainless steel welding applications mainly in the PA and PB positions. It is suitable for plate thicknesses above 2.5 mm, the ideal maximum plate thickness being approximately 6 mm.

MAX Speed operates within the spray arc range. Welding current is pulsed with constant frequency and amplitude. Arc length is controlled with the normal voltage control. MAX Speed's low-amplitude pulsing enables an effective transfer mode with lower wire feed speed than with conventional MIG/MAG arc. The pulsing is not noticeable to the welder.

>> To take MAX Speed into use, press the control panel's [welding process button](#) and select MAX Speed. The MAX Speed frequency becomes available for adjustment in the [Main view](#). The MAX Speed frequency value range is 100 ... 800 Hz, step 10 Hz, default 300 Hz.

>> To adjust the wire feed speed, in the [Main view](#), turn the left control knob. The adjustment's effect on the material thickness is also shown.

>> To fine-tune the welding voltage, in the [Main view](#), turn the right control knob.

MAX Speed supports these filler wire and shielding gas combinations:

- Fe solid & Ar + 18% CO₂ (1.0 mm, 1.2 mm)
- Fe solid & Ar + 8% CO₂ (1.0 mm, 1.2 mm)

- Fe MC & Ar + 18% CO₂ (1.2 mm)
- Ss solid & Ar + 2% CO₂ (1.0 mm, 1.2 mm).

3.4.6 Trigger logic functions

Switch between the 2T and 4T trigger logic by pressing the control panel's [trigger logic button](#).

2T

In 2T, pressing the trigger ignites the arc. Releasing the trigger switches the arc off.




4T

In 4T, pressing the trigger starts the pre gas, and releasing the trigger ignites the arc. Pressing the trigger again switches the arc off. Releasing the trigger ends the post gas.



Powerlog

Powerlog trigger logic function allows the user to switch between two or three different power levels. In Powerlog, pressing the trigger starts the pre gas, and releasing the trigger ignites the arc. A quick press of the trigger during welding switches between levels (after the last defined power level the first level is selected). Long-pressing the trigger at any of the levels during welding switches the arc off.

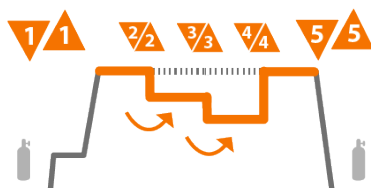

To take Powerlog into use, long-press the [trigger logic button](#) and choose whether 2 or 3 power levels are used. Set up the power levels for this function. The parameters available for adjustment for each level are:

- Wire feed speed
- Voltage / Fine tuning
- Dynamics.

 Powerlog trigger logic is not available with DPulse or MAX processes.

3.4.7 WiseFusion feature



Available in MasterMig 355 only.


The WiseFusion feature enables adaptive arc length control, which keeps the arc optimally short and focused. WiseFusion increases the welding speed and penetration and decreases heat input. WiseFusion can be used throughout the power range (short arc, globular arc and spray arc). WiseFusion is compatible with 1-MIG, MAX Position and pulsed MIG welding processes.

- >> To take WiseFusion into use, go to the control panel's [Welding parameters view](#) and apply the WiseFusion feature.
- >> To adjust the wire feed speed, in the control panel's [Main view](#), turn the left control knob.
- >> To fine tune the heat output while welding, in the control panel's [Main view](#), turn the right control knob.

For more information on Wise products, visit www.kemppi.com.

3.4.8 WeldEye with DCM (optional)

Kemppi's WeldEye welding management software is also available for use with MasterMig. For this, an additional Digital Connectivity Module (DCM) device is required. DCM is connected directly to the MasterMig's control connection with the cables and adapters delivered with the DCM device.

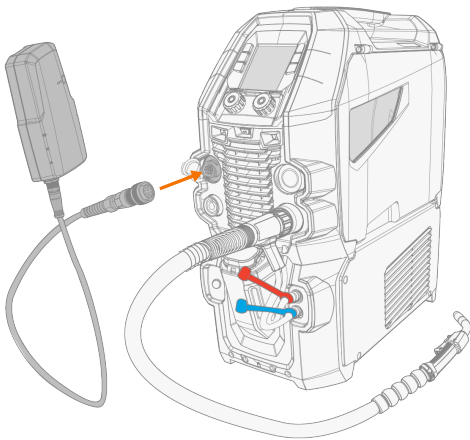

For more information on installing and using the DCM device, refer to userdoc.kemppi.com ([DCM/WeldEye](#)).

Discover WeldEye – universal welding management software

WeldEye is your primary tool and storage space for keeping your welding-related documents in order. WeldEye is a universal solution for managing welding production.

WeldEye's modular structure is based on various useful functions that serve the needs of wide-ranging industries and welding-related tasks:

- **Welding procedures**
 - >> Includes the digital library and management of dWPS, WPQR and WPS templates according to the most important welding standards.
- **Personnel and qualifications**
 - >> Includes the management and renewal processes of all personnel - welders and inspectors - qualification certificates.
- **Quality management**


- >> Includes quality verification functionalities with digital WPS and qualification compliance control against automatically collected digital welding data.
- **Welding management**
 - >> Includes document register functionalities and features for comprehensive welding project documentation and management.

For more information on WeldEye, refer to www.weldeye.com.

3.5 Using remote control

Remote control HR43

To adjust the wire feed speed, turn the knob on the remote control.

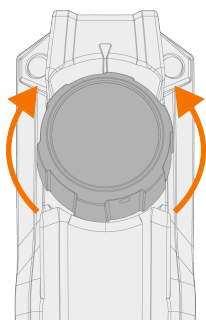


To change the memory channel instead of the wire feed speed with the remote, change the setting in the control panel settings ("Control panel: System settings" on page 42).

Remote control HR40

The HR40 control knob functions are defined by the selected welding process and reflect the adjustments of the control panel's two control knobs.

- **Control knob 1: Wire feed speed / channel**
 - >> To change the memory channel instead of the wire feed speed with the remote, change the setting in the control panel settings ("Control panel: System settings" on page 42).
 - >> You can also set the wire feed speed minimum and maximum values for the remote in the control panel settings. The minimum and maximum values affect also the resolution of the remote control adjustment.

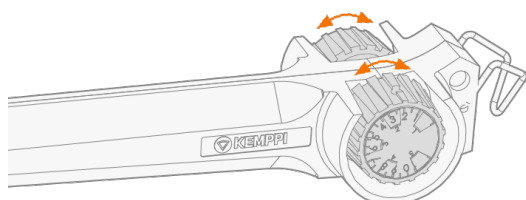

- **Control knob 2: Welding voltage / fine tuning of welding voltage**
 - >> Adjusts the welding voltage or fine tuning of welding voltage depending on the active welding process.

3.6 Changing welding polarity

Welding polarity needs to be changed for TIG welding. Also, some filler wires require changing the welding polarity. Check the recommended welding polarity on the filler wire package.

 Before handling electrical parts, ensure the welding device is disconnected from the mains.


Tools needed:




17 mm


Turn off the welding device and disconnect it from the mains.

1. Open the wire feed cabinet hatch.
2. Remove the protective rubber covers from the polarity terminals.

 Use caution when handling electrical parts.

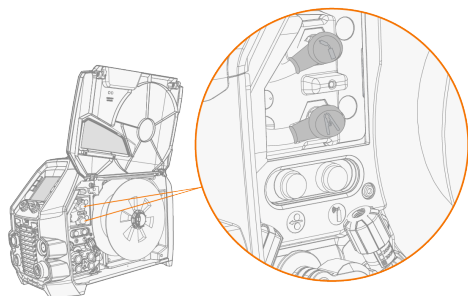

3. Remove the terminal tightening bolts and washers.

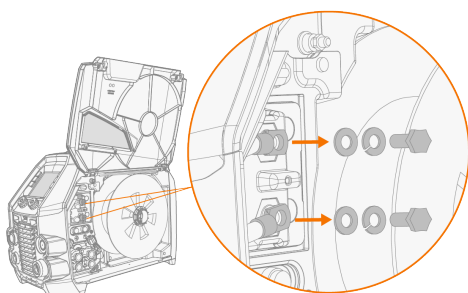


4. Connect the cables to the polarity terminals according to the polarity recommendation.
5. Replace the washers and bolts. Tighten to 17 Nm torque.
6. Replace the protective rubber covers.

3.7 Lifting MasterMig equipment

 *If a gas bottle is installed on cart, DO NOT attempt to lift the cart with the gas bottle in place.*


4-wheel cart:


1. Ensure that the welding equipment is properly secured to the cart.
2. Connect the 4-legged chain or straps from the hoist hook to the four lifting points on the cart on both sides of the welding equipment.

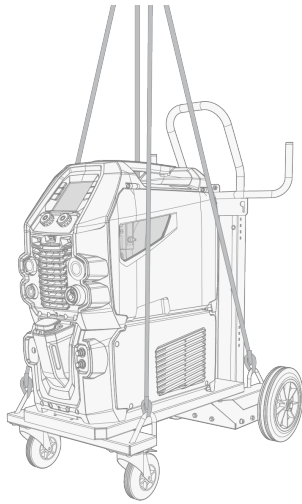

2-wheel cart (T25MT only):

1. Ensure that the welding equipment is properly secured to the cart.
2. Connect the hoist hook to the lifting handle on the cart.

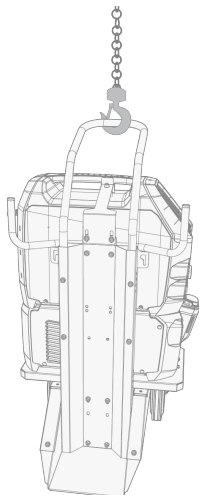

 *Do not lift the equipment when it is installed on the T35A cart.*

4. MAINTENANCE

When considering and planning routine maintenance, consider the operating frequency of the welding system and the working environment.

Correct operating of the welding machine and regular maintenance helps you avoid unnecessary downtime and equipment failure.

4.1 Daily maintenance

 *Disconnect the power source from the mains before handling electrical cables.*

Welding machine maintenance

Follow these maintenance procedures to maintain the proper functioning of the welding machine:

- Check that all covers and components are intact.
- Check all the cables and connectors. Do not use them if they are damaged and contact service for replacements.
- Check the wire feed rolls and the pressure handle. Clean and lubricate with a small quantity of light machine oil if needed.

For repairs, contact Kemppi at www.kemppi.com or your dealer.


Welding gun maintenance

For Flexlite GX MIG gun instructions, refer to userdoc.kemppi.com.

4.2 Periodic maintenance

 *Only qualified service personnel is allowed to carry out periodic maintenance.*

 *Only an authorized electrician is allowed to carry out electrical work.*

 *Before removing the cover plate, disconnect the power source from the mains and wait for about 2 minutes before discharging the capacitor.*

Check the electric connectors of the unit at least every six months. Clean oxidized parts and tighten loose connectors.

 *Where applicable, use the correct tension torque when fastening loose parts.*

Clean the outside parts of the unit from dust and dirt, for example, with a soft brush and vacuum cleaner. Also clean the ventilation grill at the back of the unit. Do not use compressed air, there is a risk that the dirt will compact even more tightly into gaps of cooling profiles.

 *Do not use pressure washing devices.*

4.3 Service workshops

Kemppi Service Workshops complete the welding system maintenance according to the Kemppi service agreement.

The main aspects in the service workshop maintenance procedure are:

- Cleanup of the machine
- Maintenance of the welding tools
- Checkup of the connectors and switches
- Checkup of all electric connections
- Checkup of the power source mains cable and plug
- Repair of defective parts and replacement of defective components
- Maintenance test
- Test and calibration of operation and performance values when needed

Find your closest service workshop at [Kemppi website](#).

4.4 Troubleshooting

i *The problems listed and the possible causes are not definitive, but suggest some typical situations that may turn up during normal use of the welding system.*

Welding device:

Problem	Recommended actions
The welding device does not power up	Check that the mains cable is plugged in properly.
	Check that the mains switch of the power source is at the ON position.
	Check that the mains power distribution is on.
	Check the mains fuse and/or the circuit breaker.
	Check that the interconnection cable between the power source and the wire feeder is intact and properly attached.
	Check that the earth return cable is connected.
The welding device stops working	Gas-cooled gun may have overheated. Wait for it to cool down.
	Check that none of the cables is loose.
	The wire feeder may have overheated. Wait for it to cool down and see that the welding current cable is properly attached.
	The power source may have overheated. Wait for it to cool down and see that the cooling fans work properly and the air flow is unobstructed.

Wire feeding:

Problem	Recommended actions
The filler wire on the spool unravels	Check that the spool locking cover is closed.
The wire feed mechanism does not feed the filler wire	Check that the filler wire has not run out.
	Check that the filler wire is properly routed through the feed rolls to the wire liner.
	Check that the pressure handle is properly closed.
	Check that the feed roll pressure is adjusted correctly for the filler wire.
	Check that the welding cable is properly connected to the wire feeder.
	Blow compressed air through the wire liner to check that it is not blocked.

Weld quality:

Problem	Recommended actions
---------	---------------------

Dirty and/or poor quality weld	Check that the shielding gas has not run out.
	Check that the shielding gas flow is unobstructed.
	Check that the gas type is correct for the application.
	Check the polarity of the gun/electrode.
	Check that the welding procedure is correct for the application.
Varying welding performance	Check that the wire feed mechanism is adjusted properly.
	Blow compressed air through the wire liner to check that it is not blocked.
	Check that the wire liner is correct for the selected wire size and type.
	Check the welding gun contact tip's size, type and wear.
	Check that the welding gun is not overheating.
	Check that the earth return clamp is properly attached to a clean surface of the workpiece.
High spatter volume	Check the welding parameter values and welding procedure.
	Check the gas type and flow.
	Check the polarity of the gun/electrode.
	Check that the filler wire is correct for the current application.

"Error codes" on the next page

4.5 Error codes

In error situations, the control panel displays the number, title and possible cause of the error, and a proposed action to fix the issue.

Error			
Code	Title	Possible cause	Proposed action
1	Power source not calibrated	Power source calibration has been lost.	Restart the power source. If problem persists, contact Kemppi service.
2	Too low mains voltage	Voltage in mains network is too low.	Restart the power source. If problem persists, contact Kemppi service.
3	Too high mains voltage	Voltage in mains network is too high.	Restart the power source. If problem persists, contact Kemppi service.
4	Power source is overheated	Too long welding session with high power.	Do not shut down, let the fans cool the machine. If fans are not running, contact Kemppi service
5	Internal 24V voltage is too low	Power source contains an inoperative 24V power supply unit .	Restart the power source. If problem persists, contact Kemppi service.
10	Unsupported welding process	There is an unsupported welding process in the memory channel.	Check that all memory channel definitions are supported.
12	Welding cable failure	Plus and minus cables are connected together.	Check the connections of welding cable and earth return cable.
13	IGBT overcurrent	Inoperative mains transformer in power source.	Restart the power source. If problem persists, contact Kemppi service.
14	IGBT overheated	Too long welding session with high power or high ambient temperature.	Do not shut down, let the fans cool the machine. If fans are not running, contact Kemppi service.
16	Main transformer is overheated	Too long welding session with high power or high ambient temperature.	Do not shut down, let the fans cool the machine. If fans are not running, contact Kemppi service
17	Phase is missing from mains supply	One or more phases are missing from the mains supply.	Check the mains cable and its connectors. Check the voltage of mains supply.
20	Power source cooling failure	Cooling capacity is reduced in the power source.	Clean the filters and clear any dirt from the cooling channel. Check that the cooling fans are running. If not, contact Kemppi service.
24	Cooling liquid overheated	Too long welding session with high power or high ambient temperature.	Do not turn off the cooler. Let the liquid circulate until the fans cool it down. If fans are not running, contact Kemppi service.
26	Cooling liquid not circulating	No cooling liquid or circulation is blocked.	Check the liquid level in the cooler. Check hoses and connectors for blockage.
27	Cooler not found	Cooling is turned on in the settings menu, but cooler is not connected to power source or cabling is faulty.	Check the cooler connections. Ensure that the cooling is turned off in the settings menu, if the cooler is not in use.
33	Welding cable calibration failure	Welding cable calibration failed.	Check the welding system cables and their connections.
35	Too high mains current	Current drawn from the mains is too high.	Reduce welding power.

40	VRD error	Open circuit voltage exceeds the VRD limit.	Restart the power source. If problem persists, contact Kemppi service.
42	High current in wire feeder motor	There may be too much pressure in the wire feed rolls or dirt in the wire line.	Adjust the feed roll pressure. Clean the wire line. Change worn parts in the welding gun.
43	Overcurrent in wire feeder motor	There may be too much pressure in the wire feed rolls or dirt in the wire line.	Adjust the feed roll pressure. Clean the wire line. Change worn parts in the welding gun.
44	Wire speed measurement is missing	Faulty sensor or wiring in wire feeder.	Restart the welding system. If problem persists, contact Kemppi service.
45	Low gas pressure	Shielding gas pressure is too low.	Check and adjust the shielding gas flow.
65	Subfeeder not allowed	Use of subfeeder is not allowed with selected welding process.	Remove the subfeeder or change the welding process.
244	Internal memory failure	Initialization failed (%sub:%device).	Restart welding system. If problem persists, contact Kemppi service.
250	Internal memory failure	Memory communication failed (%sub:%device).	Restart welding system. If problem persists, contact Kemppi service.

4.6 Installing and cleaning power source air filter (optional)

An optional power source air filter can be purchased separately. The air filter comes with a fixed casing designed to be mounted directly onto the power source air intake.


i Using the optional air filter decreases the rated power levels of the power source as follows (output 40 °C): 60% >>> 45% and 100% >>> 100%-20A. This is due to the slightly reduced cooling air intake.

Tools needed:




Installation and replacement

1. Place the air filter assembly onto the power source air intake, and lock it in place with the clips on the edge of the casing.

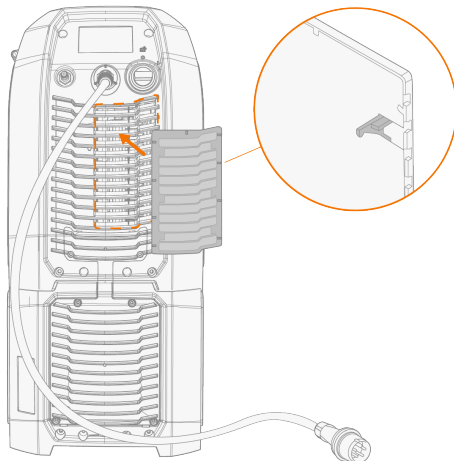

Cleansing

1. Remove the air filter from the power source by releasing the clips on the edge of the air filter casing.
2. Blow the air filter clean with compressed air.

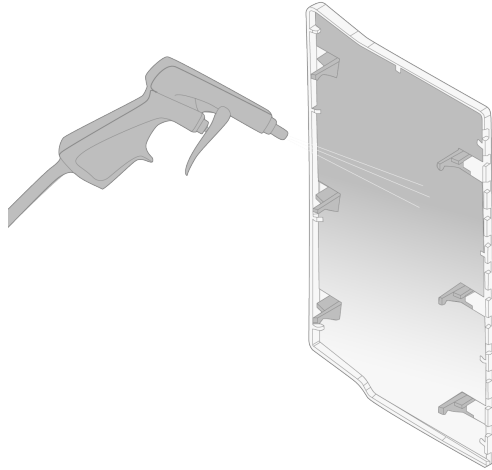

4.7 Disposal



Do not dispose of any electrical equipment with normal waste!

In observance of WEEE Directive 2012/19/EU on waste of electrical and electronic equipment and European Directive 2011/65/EU on the restriction of the use of certain hazardous substances in electrical and electronic equipment, and their implementation in accordance with national law, electrical equipment that has reached the end of its life must be collected separately and taken to an appropriate environmentally responsible recycling facility. The owner of the equipment is obliged to deliver a decommissioned unit to a regional collection center, as per the instructions of local authorities or a Kemppi representative. By applying these European Directives you improve the environment and human health.

5. TECHNICAL DATA

Technical data:

- For MasterMig device technical data, refer to "MasterMig devices" on the next page.
- For MasterMig Cooler cooling unit technical data, refer to "MasterMig cooling unit" on page 69.

Additional information:

- For wire feeder consumable information, refer to "Wire feeder consumables" on page 70.
- For ordering information, refer to "MasterMig ordering info" on page 72.

5.1 MasterMig devices

MasterMig 353 G, 355 G

MasterMig 353, 355		353 G, 355 G
Feature	Value	
Mains connection voltage	3~50 Hz	380...460 V ±10 %
Mains connection cable	HO7RN-F	4 mm ²
Input power at rated maximum current		14 kVA
Maximum supply current	I_{1max} @ 380...460 V	21.3 ... 17.1 A
Effective supply current	I_{1eff} @ 220...230 V	I_{1eff}
Idle state power consumption	MIG, TIG @400	P_{1idle}
No-load state power consumption	MMA (power save) @ 400 V	18 W
	MMA (fans ON) @ 400 V	119 W
No-load voltage	U_0	55 ... 69 V
Open circuit voltage	U_{av}	53 ... 64 V
VRD voltage	MMA	24 V
Fuse	Slow	16 A
Output at +40 °C	40 %	350 A (MMA 330 A)
	60 %	280 A
	100 % MIG	220 A
Welding current and voltage range	MIG	15 A / 10 V ... 350 A / 45 V
	TIG	15 A / 1 V ... 350 A / 45 V
	MMA	15 A / 10 V ... 330 A / 45 V
Voltage adjustment range	MIG	10 ... 40 V
Power factor at rated maximum current	@ 400 V	λ
Efficiency at rated maximum current		η
Operating temperature range		-20...+40 °C
Storage temperature range		-40...+60 °C
EMC class		A
Minimum short-circuit power of supply network		S_{SC}
Gun connection		Euro
Wire feed mechanism		4-roll, single-motor
Diameter of feed rolls		32 mm
Filler wires	Fe	0.8 ... 1.2 mm
	Ss	0.8 ... 1.2 mm
	MC/FC	0.8 ... 1.2 mm

	AI		0.8 ... 1.2 mm
Wire feed speed			0.5 ... 25 m/min
Maximum wire spool weight			20 kg
Maximum wire spool diameter			300 mm
Maximum shielding gas pressure			0.5 MPa
Control panel		Built-in	Color LCD display
Degree of protection			IP23S
External dimensions	<i>L x W x H</i>		602 x 298 x 447 mm
Package external dimensions	<i>L x W x H</i>		610 x 300 x 445 mm, with cooler 700 mm
Weight			27 kg
Voltage supply for auxiliary devices			12 V
Voltage supply for cooling unit			24 V
Recommended minimum generator power	@ 400 V	S_{gen}	20 kVA
Wired communication type			CAN
Wireless communication type			-
Standards			IEC 60974-1, -10

MasterMig 353 GM, 355 GM

MasterMig 353, 355		353 GM, 355 GM	
Feature		Value	
Mains connection voltage	3~50 Hz		220...230 V ±10 % 380...460 V ±10 %
Mains connection cable	HO7RN-F		4 mm ²
Input power at rated maximum current			14 kVA
Maximum supply current	I_{1max} @ 220...230 V	I_{1max}	21.1 ... 17 A
	I_{1max} @ 380...460 V	I_{1max}	21.3 ... 17.1 A
Effective supply current	I_{1eff} @ 220...230 V	I_{1eff}	13.3 ... 10.8 A
	I_{1eff} @ 380...460 V	I_{1eff}	13.5 ... 10.8 A
Idle state power consumption	MIG/TIG @400	P_{1idle}	20 W
No-load state power consumption	MMA (power save) @ 400 V		20 W
	MMA (fans ON) @ 400 V		120 W
No-load voltage	@ 220...230 V	U_0	54 ... 56 V
	@ 380...460 V	U_0	55 ... 69 V
Open circuit voltage		U_{av}	53 ... 64V
VRD voltage	MMA		24 V
Fuse	Slow		32 A (220...230 V) 16 A (380...460 V)

Output at +40 °C	40 %	380...460 V 220...230 V	350 A (MMA 330 A) 300 A (MMA 280 A)
	60 %	380...460 V 220...230 V	280 A 240 A
	100 %	380...460 V 220...230 V	220 A 190 A
Welding current and voltage range	MIG	380...460 V 220...230 V	15 A / 10 V...350 A / 45 V 15 A / 10 V...300 A / 40 V
	TIG	380...460 V 220...230 V	15 A / 1 V...350 A / 45 V 15 A / 1 V...300 A / 40 V
	MMA	380...460 V 220...230 V	15 A / 10 V...330 A / 45 V 15 A / 10 V...300 A / 40 V
Voltage adjustment range	MIG		10 ... 40 V
Power factor at rated maximum current	@ 400 V	λ	0.91
Efficiency at rated maximum current		η	87 %
Minimum short-circuit power of supply network		S_{SC}	2.4 MVA
Gun connection			Euro
Wire feed mechanism			4-roll, single-motor
Diameter of feed rolls			32 mm
Filler wires	Fe		0.8 ... 1.2 mm
	Ss		0.8 ... 1.2 mm
	Mc/Fc		0.8 ... 1.2 mm
	Al		0.8 ... 1.2 mm
Wire feed speed			0.5 ... 25 m/min
Maximum wire spool weight			20 kg
Maximum wire spool diameter			300 mm
Maximum shielding gas pressure			0.5 MPa
Control panel		Built-in	Color LCD display
Operating temperature range			-20...+40 °C
Storage temperature range			-40...+60 °C
EMC class			A
Degree of protection			IP23S
External dimensions	<i>L x W x H</i>		602 x 298 x 447 mm
Package external dimensions	<i>L x W x H</i>		610 x 300 x 445 mm, with cooler 700 mm
Weight			27 kg
Voltage supply for auxiliary devices			12 V
Voltage supply for cooling unit		380...460 V	24 V
		220...230 V	24 V

Recommended minimum generator power	@ 400 V	S_{gen}	20 kVA
Wired communication type			CAN
Wireless communication type			-
Standards			IEC 60974-1, -10

5.2 MasterMig cooling unit

MasterMig Cooler

MasterMig Cooler		
Feature		Value
Supply voltage	U_1	380...460 V +/- 10 %
Maximum supply current	@ 380...460 V I_{1max}	0.7 A
Cooling power	@ 1 l/min	1.0 kW
Recommended coolant		MGP 4456 (Kemppi mixture)
Maximum coolant pressure		0.4 MPa
Tank volume		3 l
Operating temperature range	With recommended coolant	-20...+40 °C
Storage temperature range		-40...+60 °C
EMC class		A
Degree of protection	When mounted	IP23S
Package external dimensions	$L \times W \times H$	635 x 305 x 292 mm
Weight	Without accessories	14.9 kg
Standards		IEC 60974-2, -10

MasterMig Cooler M

MasterMig Cooler M		
Feature		Value
Supply voltage	U_1	220...240 V +/- 10 % 380...460 V +/- 10 %
Maximum supply current	@ 220...230 V I_{1max}	1.0 A
	@ 380...460 V I_{1max}	0.7 A
Cooling power	@ 1 l/min	1.0 kW
Recommended coolant		MGP 4456 (Kemppi mixture)
Maximum coolant pressure		0.4 MPa
Tank volume		3 l
Operating temperature range	With recommended coolant	-20...+40 °C
Storage temperature range		-40...+60 °C
EMC class		A
Degree of protection	When mounted	IP23S
Package external dimensions	$L \times W \times H$	635 x 305 x 292 mm
Weight	Without accessories	14.9 kg
Standards		IEC 60974-2, -10

5.3 Wire feeder consumables

This section lists the feed rolls and wire guide tubes available both separately and in consumable kits. The consumable kits contain recommended feed roll and wire guide tube combinations for selected filler wire materials and diameters. The wire feeder consumables can be ordered in Configurator.kemppi.com.

In the tables, *standard* refers to plastic feed rolls and *heavy-duty* refers to metal feed rolls. The materials mentioned first refer to primary suitability and the materials mentioned inside brackets refer to secondary suitability.

Wire feeder consumable kits

The table below lists the recommended consumable kits for selected filler wire materials and diameters.

Wire feeder consumable kits				
Filler wire material	Feed roll profile*	Filler wire diameter (mm)	Consumable kit code, standard	Consumable kit code, heavy-duty
Fe (MC/FC)	V-groove	0.8–0.9	F000488	F000492
		1.0	F000489	F000493
		1.2	F000490	F000494
Ss (Fe, Cu)	V-groove	0.8–0.9	F000455	-
		1.0	F000456	-
		1.2	F000457	-
Ss (Fe)	V-groove	0.8–0.9	-	F000458
		1.0	-	F000459
		1.2	-	F000460
MC/FC	V-groove, knurled	1.0	F000499	F000502
		1.2	F000500	F000503
Al	U-groove	1.0	F000461	-
		1.2	F000462	-

Wire guide tubes

The table below lists the wire guide tubes available.

Wire guide tubes				
Filler wire material	Filler wire diameter (mm)	Inlet guide tube	Middle guide tube	Outlet guide tube
Al, Ss (Fe, MC/FC)	0.6	SP007293	SP007273	SP016608
	0.8–0.9	SP007294	SP007274	SP011440
	1.0	SP007295	SP007275	SP011441
	1.2	SP007296	SP007276	SP011442
Fe, MC/FC	0.6	(SP007293)	(SP007273)	SP016613
	0.8–0.9	SP007536	(SP007274)	SP016614
	1.0	SP007537	(SP007275)	SP016615
	1.2	SP007538	(SP007276)	SP016616

Feed rolls




The table below lists the standard feed rolls available.

Feed rolls, standard				
Filler wire material	Feed roll profile*	Filler wire diameter (mm)	Drive roll code	Pressure roll code
Fe, Ss, Cu (Al, MC/FC)	V-groove	0.6	W001045	W001046
		0.8–0.9	W001047	W001048
		1.0	W000675	W000676
		1.2	W000960	W000961
MC/FC (Fe)	V-groove, knurled	1.0	W001057	W001058
		1.2	W001059	W001060
Al (MC/FC, Ss, Fe, Cu)	U-groove	1.0	W001067	W001068
		1.2	W001069	W001070

The table below lists the heavy-duty feed rolls available.

Feed rolls, heavy-duty				
Filler wire material	Feed roll profile*	Filler wire diameter (mm)	Drive roll code	Pressure roll code
Fe, Ss (MC/FC)	V-groove	0.8–0.9	W006074	W006075
		1.0	W006076	W006077
		1.2	W004754	W004753
MC/FC (Fe)	V-groove, knurled	1.0	W006080	W006081
		1.2	W006082	W006083
(MC/FC, Ss, Fe)	U-groove	1.0	W006088	W006089
		1.2	W006090	W006091

* Feed roll profiles and corresponding symbols:

Feed roll profile	Symbol
V-groove	
V-groove, knurled	
U-groove	

5.4 MasterMig ordering info

For MasterMig ordering information and optional accessories, refer to [Kemppi.com](https://www.kemppi.com).